



# Vehicle History Summary

Quadrio Earthmoving

|                 |                   |
|-----------------|-------------------|
| Fleet #         | RT05              |
| Registration    | 1BNH021           |
| Make            | Mack              |
| Model           | TITAN             |
| VIN / Chassis # | 6FMBO5CO43D709667 |
| Build Date      | 2003              |

| Number | Date       | Kms    | Hours | Type                             | Repairer Notes   | Repairer                    |
|--------|------------|--------|-------|----------------------------------|--|-----------------------------|
| R-627  | 13/03/2019 |        |       | AIRCON                           | Short in wiring to red dot fan. Diagnose and fix issue. Check pressures and vent temp.   |                             |
| R-331  | 20/02/2019 |        |       | SHOCKYS                          | Replaced LH rear shocky. Waiting on 3x more. Complete as per Rob's advice  |                             |
| R-582  | 18/02/2019 |        |       | AIR LINE, DIFFERENTIAL, MUDGUARD | Removed bolts from mudguard. Made up plate, installed bolts to mudguard. Is secure and doesn't flop around. Broken air line under seat. Cut air line and put joiner in. Test-all good. Tightened diff support bracket bolts. Need to get loctite 270 to put on studs, which is a thread locker. Retaining compound wont do the job |                             |
| R-490  | 14/02/2019 |        |       | SEALS                            | Completed as per Todd's advice   |                             |
| S-71   | 28/01/2019 | 251738 | 4608  | A                                | 500hr service completed by A.Brown   |                             |
| R-376  | 23/01/2019 |        |       | DIFFERENTIAL                     | Torsion rod housing studs have been replaced and loctite in. Ran for a day and hasnt come loose. Inspected wheel seal, found grease in RHF drive hub. Degreased and washed. Took for 50km drive-no sign of oil leak. Sent back to work.  |                             |
| R-338  | 08/01/2019 |        | 4455  | Brakes                           | Replaced booster RH front and hose with one new fitting.   |                             |
| R-333  | 07/01/2019 |        |       | BRACKET                          | New washers to fit hinges Tightened radiator bolts   |                             |
| R-241  | 07/01/2019 | 0      | 0     | LIGHTS                           | Fitted headlights RH side H4 and LH high beam. Broken wire to RH side highbeam-tested New globe placed in LH front indicator High beam stick loose near steering wheel tightened up Fitted new light switch to rocker Tested aircon Check all lights on trailer-All ok   | QUADRIO EARTHMOVING PTY LTD |

| Number | Date       | Kms | Hours | Type                                | Repairer Notes   | Repairer                    |
|--------|------------|-----|-------|-------------------------------------|--|-----------------------------|
| R-323  | 15/12/2018 |     |       | BATTERY                             | Removed the 4 old batteries out of truck, installed 4 new batteries. Ran up-tested-all good.   |                             |
| R-318  | 14/12/2018 |     |       | STARTER MOTOR                       | Drive to water 94 and look at truck. Starter motor faulty and battery flat from trying to start. Replaced with new starter motor and charged up batteries with car. Tested voltage and that alternator was charging. Ok  |                             |
| S-51   | 02/12/2018 | 0   | 0     | B                                   | SERVICE COMPLETE   |                             |
| R-65   | 22/10/2018 | 0   | 0     | WIPERS                              | No 12v power supply. Switch appears to be off colour. Circuit may of shorted out. TRUCK NEEDED TO BE RETURNED TO SERVICE Current weather conditions do not require wiper operations so will carry out further investigation when time can be allocated 23/10/2018-Wipers checked and all working ok-Boggles  | QUADRIO EARTHMOVING PTY LTD |
| R-199  | 21/10/2018 |     |       | AXLE, BEARING, SEALS                | Removed rear axle housing & replaced with one from back of yard. Cleaned up axle and fitted with new bearing and seal to wheel ends & fill hub with oil  |                             |
| I-22   | 10/10/2018 |     |       | Wear & Tolerances Inspection/Record | Brakes replaced All other items within limits  |                             |
| R-87   | 09/10/2018 | 0   | 0     | BRAKES                              | Carried out quick drive axle brake inspection & found all 4 brake sets worn to almost end of lifespan. Repair parts to be added to sept/oct parts list Repairs carried out during service s13  | QUADRIO EARTHMOVING PTY LTD |
| R-147  | 09/10/2018 | 0   | 0     | BRAKES                              | Repaired during service s13  |                             |
| R-52   | 09/10/2018 | 0   | 0     | RADIATOR, SLACK ADJUSTER            | Repaired during service s13  | QUADRIO EARTHMOVING PTY LTD |
| S-13   | 09/10/2018 | 0   | 3957  | A                                   | Service complete Coolant alarm sensor repaired Electric horn currently not working Air filters replaced Changed both diff oils Trans oil changed RHR mudflap is missing All brake pads and hubs replaced Front axle replaced LHR shocky replaced Changed 1way air valve for rear boosters Replaced all slack adjusters Replaced jack shaft uni joints Free'd up and greased all scam tubes R52 complete R87 complete R147 complete |                             |

| Number | Date       | Kms    | Hours  | Type                        | Repairer Notes  | Repairer                    |
|--------|------------|--------|--------|-----------------------------|---|-----------------------------|
| R-72   | 15/09/2018 | 0      | 3837   | CLUTCH, Steering            | Steering stiff Clutch faulty & tapping noise from engine. Checked and unable to adjust clutch. Ring gear and pinion locked up. Stop clutch badly worn. Throw out and through shaft dry. Carried out valve clearance adjustments but tapping noise still in engine. Rob cut open oil filter & found metal contamination. Engine & clutch require replacement. Could not fault stiffness in steering. Removed & replaced engine and clutch assy. Located jammed 1 way valve in fuel filter housing that was cause of accelerator fault. | QUADRIO EARTHMOVING PTY LTD |
| R-77   | 28/08/2018 | 0      | 0      | FAN BELT, HOSE              | Replaced water supply hose  | QUADRIO EARTHMOVING PTY LTD |
| R-31   | 22/08/2018 | 0      | 0      | INDICATOR                   | HEADLIGHTS FIXED - INSTALLED NEW 7 PIN TRAILER PLUG REPAIRED SPRAY & DRIBBLE BAR FAULTS   | QUADRIO EARTHMOVING PTY LTD |
| S-3    | 03/08/2018 | 212423 | 0      | A                           |   | QUADRIO EARTHMOVING PTY LTD |
| R-66   | 02/08/2018 | 0      | 0      | BONNET                      | repaired bonnet spring mounting arrangement   | QUADRIO EARTHMOVING PTY LTD |
| R-56   | 25/07/2018 | 0      | 0      | GREASE LINES, HEADLIGHTS    | Replace RH headlight globe<br>Replaced & Adjusted ALT/AC drive belts<br>Replaced RHR & LHR ROCKER BOX bushes and pins on ST01<br>Replaced LHR ROCKER BOX & bushes on DL05<br>Repaired split turntable grease lines with 1/4" joiners<br>Replaced RH beacon with second unit in w/shop parts container.<br>Located corroded wiring in rear junction box of ST16-cut out & rejoined/soldered wiring back together.  | QUADRIO EARTHMOVING PTY LTD |
| I-11   | 08/04/2018 |        | 234220 | WAHVA Roadworthy Inspection |   |                             |
| R-459  | 07/02/2018 |        |        | FAULT FIND                  | Start fault-No ECM power-Elliot Baer  |                             |
| S-67   |            |        |        | C                           |   |                             |
| I-17   |            |        |        | WAHVA Roadworthy Inspection |   |                             |
| R-630  |            |        |        | MUDGUARD, SEAT, WHEEL SEAL  |   |                             |

Signed: \_\_\_\_\_

Name: \_\_\_\_\_

Date: \_\_\_\_\_

NOT VERIFIED